
FA-300-6L Firmware Upgrade (ECO-08-47)

The FA-300-6L firmware has been upgraded from **version 1.1.4** to **version 1.1.6**. The following are the changes and enhancements that were made:

- Corrected the problem where the dialer occasionally missed the SIA kiss-off tone and reported the same event repeatedly.
- Corrected the problem where the dialer occasionally reported a false telephone line trouble (missing dial tone) that is caused by the dial-tone detection circuit. In the new release, the dial-tone detection is removed from the line supervision and is only checked when the dialer seizes the telephone line for reporting.

All FA-300-6L panels without dialers are not affected.

The new firmware can be programmed into existing systems using the MSW-017 Firmware Upgrade Utility Program version 1.0.3.

The new firmware file is available on the Mircom website; Public download section.

If you have any questions or concerns, please contact the Technical Support Department.